

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (i) of this AD. Information may be emailed to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR-520, Continued Operational Safety Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(i) Related Information

For more information about this AD, contact Katherine Venegas, Aviation Safety Engineer, FAA, 3960 Paramount Boulevard, Lakewood, CA 90712; phone: 562-627-5353; email: katherine.venegas@faa.gov.

(j) Material Incorporated by Reference

None.

Issued on November 18, 2024.

Peter A. White,

Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2024-27330 Filed 11-21-24; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2024-2410; Project Identifier AD-2024-00509-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 787-8, 787-9, and 787-10 airplanes.

This proposed AD was prompted by possible horizontal stabilizer pivot pin lockring, outer pivot pin, and outboard spacer misalignment at final assembly. This proposed AD would require inspection of the left-side and right-side horizontal stabilizer pivot pin assemblies for misalignment and incorrect gapping, and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by January 6, 2025.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2024-2410; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For Boeing material identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2024-2410.

FOR FURTHER INFORMATION CONTACT:

Joseph Hodgkin, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3962; email: Joseph.J.Hodgkin@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2024-2410; Project Identifier AD-2024-00509-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Joseph Hodgkin, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3962; email: Joseph.J.Hodgkin@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA has received a report indicating possible horizontal stabilizer pivot pin lockring, outer pivot pin, and outboard spacer misalignment at final assembly. One operator further reported a left side pivot assembly that did not have a visible gap between the outboard nut and trap fitting. A misaligned pivot

pin lockring caused a pivot pin outboard spacer to not be set flush against the horizontal stabilizer pivot bearing and outboard washer. Decreased lateral load capacity can cause the loss of pivot pin retention parts. This condition, if not addressed, could result in the loss of the horizontal stabilizer and continued safe flight & landing.

FAA’s Determination

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024. This material specifies procedures for a detailed inspection of the left-side and right-side horizontal stabilizer pivot pin assemblies for misalignment and incorrect gapping and applicable on-condition actions. On-condition actions include replacement of the left or right horizontal stabilizer pivot pin assembly if any misalignment or incorrect gapping is found.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the material already described, except for any differences identified as exceptions in the regulatory text of this proposed AD. For information on the procedures and compliance times, see this material at *regulations.gov* under Docket No. FAA–2024–2410.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 145 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection	2 work-hours × \$85 per hour = \$170	\$0	\$170	\$24,650

The FAA estimates the following costs to do any necessary replacements that would be required based on the

results of the proposed inspection. The agency has no way of determining the

number of aircraft that might need this replacement:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replacement	12 work-hours × \$85 per hour = \$1,020	\$47,730	\$48,750

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of

that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

The Boeing Company: Docket No. FAA–2024–2410; Project Identifier AD–2024–00509–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by January 6, 2025.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 787–8, 787–9, and 787–10 airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024.

(d) Subject

Air Transport Association (ATA) of America Code 55, Stabilizers.

(e) Unsafe Condition

This AD was prompted by possible misalignment, at final assembly, of the horizontal stabilizer pivot pin locking, outer pivot pin, and outboard spacer. The FAA is issuing this AD to address a pivot pin outboard spacer that is not set correctly flush against the horizontal stabilizer pivot bearing and outboard washer, caused by a misaligned pivot pin locking. The unsafe condition, if not addressed, could result in decreased lateral load capacity, which could cause the loss of pivot pin retention parts and lead to loss of the horizontal stabilizer and loss of continued safe flight and landing.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin B787–81205–SB550013–00, Issue 001, dated August 30, 2024, which is referred to in Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024.

(h) Exception to Requirements Bulletin Specifications

Where the Compliance Time columns of the tables in the “Compliance” paragraph of Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024, refers to the Issue 001 date of Requirements Bulletin B787–81205–SB550013–00 RB, this AD requires using the effective date of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, AIR–520, Continued Operational Safety Branch, FAA, has the

authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR–520, Continued Operational Safety Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Joseph Hodgin, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206–231–3962; email: Joseph.J.Hodgin@faa.gov.

(2) Material identified in this AD that is not incorporated by reference is available at the address specified in paragraph (k)(3) this AD.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Requirements Bulletin B787–81205–SB550013–00 RB, Issue 001, dated August 30, 2024.

(ii) [Reserved]

(3) For Boeing material identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; website myboeingfleet.com.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on November 12, 2024.

Peter A. White,

Deputy Director, Integrated Certificate Management Division, Aircraft Certification Service.

[FR Doc. 2024–27327 Filed 11–21–24; 8:45 am]

BILLING CODE 4910–13–P

POSTAL REGULATORY COMMISSION**39 CFR Part 3050**

[Docket No. RM2025–4; Order No. 8002]

Periodic Reporting

AGENCY: Postal Regulatory Commission.

ACTION: Notice of proposed rulemaking.

SUMMARY: The Commission is acknowledging a recent Postal Service filing requesting the Commission initiate a rulemaking proceeding to consider changes to analytical principles relating to periodic reports. This document informs the public of the filing, invites public comment, and takes other administrative steps.

DATES: *Comments are due:* December 10, 2024.

ADDRESSES: Submit comments electronically via the Commission’s Filing Online system at <https://www.prc.gov>. Those who cannot submit comments electronically should contact the person identified in the **FOR FURTHER INFORMATION CONTACT** section by telephone for advice on filing alternatives.

FOR FURTHER INFORMATION CONTACT: David A. Trissell, General Counsel, at 202–789–6820.

SUPPLEMENTARY INFORMATION:**Table of Contents**

- I. Introduction
- II. Proposal
- III. Notice and Comment
- IV. Ordering Paragraphs

I. Introduction

On November 13, 2024, the Postal Service filed a petition pursuant to 39 CFR 3050.11 requesting that the Commission initiate a rulemaking proceeding to consider changes to analytical principles relating to periodic reports.¹ The Petition presents a methodology for developing shape-specific labor productivity data for non-MODS manual distribution activities using eFlash volumes and workhours derived from costs for the corresponding In-Office Cost System (IOCS)-based non-MODS cost pools. Petition at 1.

II. Proposal

Background. The Postal Service states that measuring labor productivity associated with manual letter and flat distribution operations “is a longstanding challenge for modeling the

¹ Petition of the United States Postal Service to Initiate a Proceeding to Change Analytical Principles and Notice of Filing Non-Public Materials, November 13, 2024 (Petition). The proposed change is attached to the Petition (Proposal).