

Manual (AMM) 64–21–00.6–27A or 64–21–00.6–27B, dated earlier than March 5, 2024.

(4) Where paragraph (2) of EASA AD 2024–0113 specifies “discrepancies as identified in the ASB are,” this AD requires replacing that text with, “a discrepancy, which is defined as a crack, nail-sensitive scratch, deformed lamella, broken lamella, mark, circular contact indication (other than those on the first and last lamella of the tension-torsion bar), or the P/N is not written on the first and the last lamella, is.”

(5) Where paragraph 3 of EASA AD 2024–0113 specifies “an aeroplane,” this AD requires replacing that text with “any helicopter.”

(6) Where the material referenced in EASA AD 2024–0113 specifies to discard parts, this AD requires removing those parts from service.

(7) Where the material referenced in EASA AD 2024–0113 specifies actions for non-installed equipment or parts, this AD does not require those actions.

(8) This AD does not adopt the “Remarks” section of EASA AD 2024–0113.

(i) No Reporting Requirement

Although the material referenced in EASA AD 2024–0113 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Special Flight Permits

Special flight permits are prohibited.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD and email to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The following provisions also apply to this AD.

(l) Additional Information

For more information about this AD, contact Tara Lucas, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (206) 231–3189; email: tara.lucas@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2024–0113, dated June 13, 2024.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3,

50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222 5110.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on May 1, 2025.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2025–08078 Filed 5–8–25; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2025–0750; Project Identifier MCAI–2022–01325–R]

RIN 2120–AA64

Airworthiness Directives; Airbus Helicopters Deutschland GmbH Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus Helicopters Deutschland GmbH (AHD) Model MBB–BK 117 D–3 helicopters. This proposed AD was prompted by reports of momentary direct current (DC) power interruption in flight of both essential busses. This proposed AD would require revising the existing rotorcraft flight manual (RFM) for your helicopter, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by June 23, 2025.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to regulations.gov. Follow the instructions for submitting comments.

- **Fax:** (202) 493–2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2025–0750; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website ad.easa.europa.eu.

- You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Parkway, Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. It is also available at regulations.gov under Docket No. FAA–2025–0750.

FOR FURTHER INFORMATION CONTACT: Dan McCully, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (303) 342–1080; email: william.mccully@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2025–0750; Project Identifier MCAI–2022–01325–R” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to

regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Dan McCully, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2022–0208, dated October 11, 2022 (EASA AD 2022–0208) (also referred to as the MCAI), to correct an unsafe condition on certain serial-numbered AHD Model MBB–BK117 D–3 and D–3m helicopters. This proposed AD was prompted by reports of momentary DC power interruption in flight of both essential busses. The investigation is still ongoing to identify the root cause of this occurrence. In the interim, AHD developed emergency and malfunction procedures to address this issue. The FAA is proposing this AD to address DC power interruption, which could result in loss of control of the helicopter or reduced situational awareness.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA–2025–0750.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed EASA AD 2022–0208, which specifies procedures for revising the RFM by incorporating an emergency and malfunction procedure, informing all flight crews, and thereafter, operating the helicopter accordingly. This material provides

updated battery discharging procedures, which includes a warning in case of total electrical failure.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2022–0208, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD. See "Differences Between this AD and the MCAI" for a discussion of the general differences included in this AD. The owner/operator (pilot) holding at least a private pilot certificate may revise the existing RFM for your helicopter and must enter compliance with the applicable paragraph of the proposed AD into the helicopter maintenance records in accordance with 14 CFR 43.9(a) and 91.417(a)(2)(v).

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022–0208 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2022–0208 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Material required by EASA AD 2022–0208 for compliance will be available at *regulations.gov* under Docket No. FAA–

2025–0750 after the FAA final rule is published.

Differences Between This NPRM and the EASA AD

EASA AD 2022–0208 applies to Model MBB–BK117 D–3m helicopters, whereas this proposed AD would not because that model is not FAA type-certificated.

The MCAI requires operators to "inform all flight crew" of the revisions to the RFM, and thereafter to "operate the helicopter accordingly." However, this AD does not require those actions as those actions are already required by FAA regulations. FAA regulations require operators furnish to pilots any changes to the RFM (for example, 14 CFR 135.21) and to ensure the pilots are familiar with the RFM (for example, 14 CFR 91.505). As with any other flight crew training requirement, training on the updated RFM content is tracked by the operators and recorded in each pilot's training record, which is available for the FAA to review. FAA regulations also require pilots to follow the procedures in the existing RFM including all updates. Therefore, including a requirement in this AD to inform the flight crew and operate the helicopter according to the revised RFM would be redundant and unnecessary.

Interim Action

The FAA considers this proposed AD would be an interim action. If final action is later identified, the FAA might consider further rulemaking then.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 27 helicopters of U.S. Registry. Labor rates are estimated at \$85 per hour. Based on these numbers, the FAA estimates the following costs to comply with this proposed AD.

Revising the existing RFM for your helicopter would take 1 work-hour for an estimated cost of \$85 per helicopter and \$2,295 for the U.S. fleet.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil

aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus Helicopters Deutschland GmbH (AHD): Docket No. FAA–2025–0750; Project Identifier MCAI–2022–01325–R.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by June 23, 2025.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Helicopters Deutschland GmbH (AHD) Model MBB–BK 117 D–3 helicopters, certificated in any

category, as identified in European Union Aviation Safety Agency AD 2022–0208, dated October 11, 2022 (EASA AD 2022–0208).

(d) Subject

Joint Aircraft Service Component (JASC) Code: 2432, Battery/Charger System.

(e) Unsafe Condition

This AD was prompted by reports of momentary direct current (DC) power interruption in flight of both essential busses. The FAA is issuing this AD to address DC power interruption through updated procedures. The unsafe condition, if not addressed, could result in loss of control of the helicopter or reduced situational awareness.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022–0208. The owner/operator (pilot) holding at least a private pilot certificate may revise the existing RFM for your helicopter and must enter compliance with this paragraph of the AD into the helicopter maintenance records in accordance with 14 CFR 43.9(a) and 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417, 121.380, or 135.439.

(h) Exceptions to EASA AD 2022–0208

(1) Where paragraph (1) of EASA AD 2022–0208 specifies to inform all flight crews and operate the helicopter accordingly, this AD does not require those actions.

(2) Where paragraph (2) of EASA AD 2022–0208 specifies “the RFM emergency and malfunction procedure, is an acceptable method” this AD requires replacing that text with “the RFM emergency and malfunction procedure, as defined in this AD, is an acceptable method.”

(3) This AD does not adopt the “Remarks” section of EASA AD 2022–0208.

(i) Special Flight Permit

Special flight permits are prohibited.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD and email to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Related Information

For more information about this AD, contact Dan McCully, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (303) 342–1080; email: william.mccully@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0208, dated October 11, 2022.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Parkway, Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on May 5, 2025.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2025–08075 Filed 5–8–25; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF HEALTH AND HUMAN SERVICES

Food and Drug Administration

21 CFR Part 101

[Docket No. FDA–2024–N–2910]

RIN 0910–AI80

Food Labeling: Front-of-Package Nutrition Information; Extension of Comment Period

AGENCY: Food and Drug Administration, HHS.

ACTION: Proposed rule; extension of comment period.

SUMMARY: The Food and Drug Administration (FDA or we) is extending the comment period for the proposed rule entitled “Food Labeling: Front-of-Package Nutrition Information” that appeared in the **Federal Register** of